



TRI-COUNTY INSPECTIONS

"Shielding You From The Unknown!"


RADON INSPECTION REPORT

Document Generated

02/09/2022

Document Number

RP22008240022_05Oct21_1916

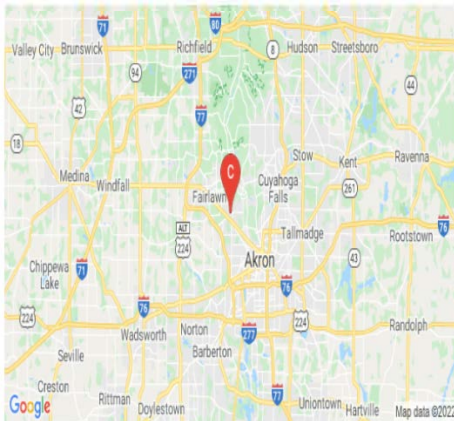

SAMPLE

Test Performed For

Potential Client

Device S/N

RP22008240022

Measurement Date

10/05/2021 19:16 ~ 10/07/2021 19:16

Inspection Duration

48hour (Data No : 48)

Measurement Location

33312 Vineyard Park

Avon, Ohio 44011

Inspector

Mike Vakos (OH Radon License RT1657)

Inspector Phone

4406531947

Inspector Address

**33312 Vineyard Park
Avon, Ohio, 44011**

MEASUREMENT ENVIRONMENTS

GENERAL HOUSE CONDITIONS:

Test Category? (Initial, Follow-Up, Post-Mitigation): Initial

Building Type? (Single Family, Townhouse, Apartment, etc.): Single Family

Occupancy? (Vacant or Occupied): Occupied

Foundation Type? (Basement, Slab on Grade, Crawl Space): Basement

WEATHER CONDITIONS:

Sustained Wind Velocity Above 30mph? (Yes, No, Unknown, N/A): No

Abnormal Weather Conditions? (Yes, No,): No

TAMPER CONTROLS:

Tamper Indicating Controls Used? (Yes, No): Yes

Description of Tamper Controls: TAMPER MONITOR WAS USED



Test Started

10/05/2021 19:16

Test Ended

10/07/2021 19:16

Inspection Duration

48 hours

Calibrated

08/24/2020

Wait Time

0 hour

Radon Concentration Max

11.8

Radon Concentration Min

5.5

Radon Concentration Avg.

9.0

EPA Protocol Average


9.3

NOTE: The calibrated EPA average excludes the first 4 measures to follow EPA Protocol.



COMMENTS

Radon monitor was placed in the basement.

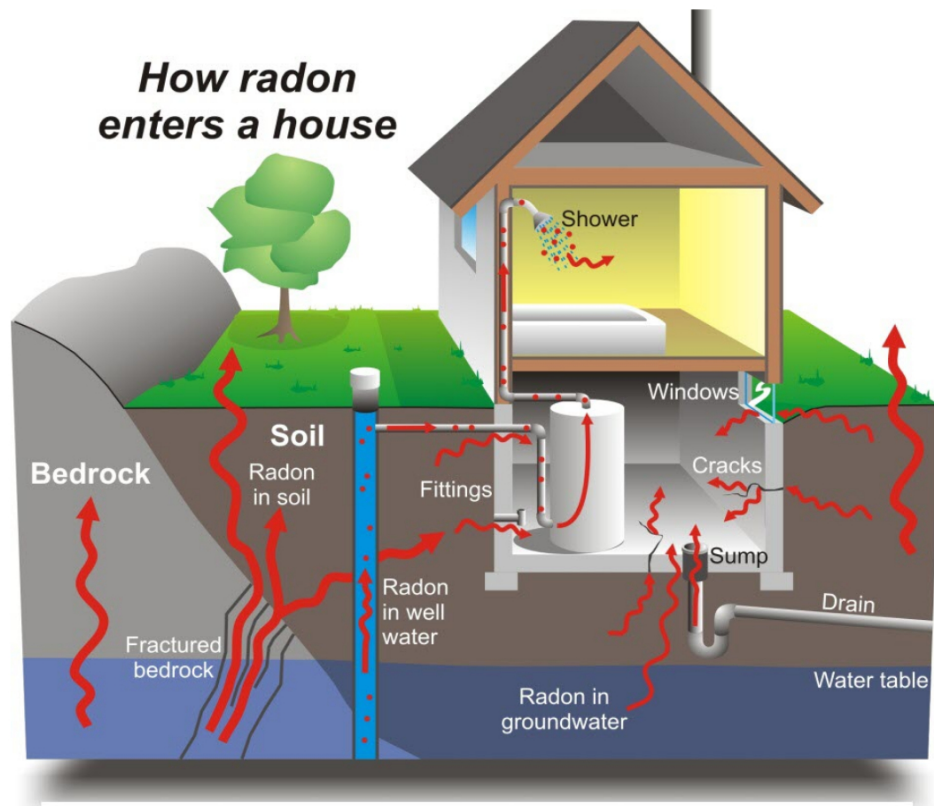

IMPORTANT NOTICE

**IF YOUR RADON TEST RESULT IS AT OR ABOVE EPA's
4.0 pCi/L ACTION LEVEL**

**THE EPA AND YOUR STATE RADON PROGRAM RECOMMEND THIS
HOME BE MITIGATED**

Table of Hourly Radon Measurements

Radon Concentration Average: 9.0 pCi/ℓ

Timestamp	Radon Value	Temp(F)	RH(%)	Timestamp	Radon Value	Temp(F)	RH(%)
10/05/21 08:16 PM	5.8	68	56	10/06/21 08:16	9.2	68	56
10/05/21 09:16	6.4	68	55	10/06/21 09:16	7.8	68	56
10/05/21 10:16	6.5	68	55	10/06/21 10:16	8.5	68	56
10/05/21 11:16	5.9	68	55	10/06/21 11:16	8.2	68	56
10/06/21 00:16 AM	5.5	68	55	10/07/21 00:16 AM	8.6	68	57
10/06/21 01:16	6.1	68	55	10/07/21 01:16	8.9	68	57
10/06/21 02:16	6.6	68	55	10/07/21 02:16	8.8	68	57
10/06/21 03:16	9.1	68	55	10/07/21 03:16	9.1	68	57
10/06/21 04:16	6.8	68	55	10/07/21 04:16	10.5	68	57
10/06/21 05:16	7.8	68	55	10/07/21 05:16	10.5	68	57
10/06/21 06:16	8.9	68	55	10/07/21 06:16	10.6	68	57
10/06/21 07:16	8.9	68	55	10/07/21 07:16	11.1	68	57
10/06/21 08:16	8.9	68	56	10/07/21 08:16	11.2	68	57
10/06/21 09:16	9.1	68	56	10/07/21 09:16	11.7	68	57
10/06/21 10:16	7.7	68	56	10/07/21 10:16	11.3	68	57
10/06/21 11:16	9.6	68	56	10/07/21 11:16	11.4	68	57
10/06/21 12:16 PM	10.4	68	56	10/07/21 12:16 PM	11.2	68	57
10/06/21 01:16	10.0	68	56	10/07/21 01:16	11.4	68	57
10/06/21 02:16	9.9	68	56	10/07/21 02:16	11.8	68	57
10/06/21 03:16	10.6	68	56	10/07/21 03:16	10.5	68	57
10/06/21 04:16	8.0	68	56	10/07/21 04:16	9.4	68	57
10/06/21 05:16	8.8	68	56	10/07/21 05:16	10.4	68	57
10/06/21 06:16	7.4	68	56	10/07/21 06:16	9.9	68	57
10/06/21 07:16	8.2	68	56	10/07/21 07:16	8.9	68	57

* Temperature and humidity can vary depending on environmental conditions.